INFORMATION

CENTRAL INTELLIGENCE AGENCY

						25X1
						25X1
						25X1
						25X1
						25X1
						25X1
						25X1
						25X1
			<u>, </u>			
				which was belied al destinations		armament pro-
	keyed to an	explanatory 1	Legend. The	factory, include ne report also	gives info	rmation on
	tools and in	struments, qu	uality and	quality contro	ol, rate of	rejects, ious buildings
	gives inform	ation on prod	duction, la	tor Factory) in abor force, fa	cilities and	d machinery,
					concerning	
					. 8	
	SCHRCE EVALUE	THOMS ARE DEEL	MITTUE ADDE	AISAL OF CONTEN	IT IC TENITATIVI	
LACE & ATE ACQ.	COLIDOR EVALUA	ATIONS ARE DEFI	LUTN (F. A. D.S.			25>
ATE OF				REFERENCES		25 X 1
	PROCES			REQUIREMENT NO.	RD	
		g Traktorgyan Factory), Bi		NO. PAGES	1	25X1
UBJECT				DATE DISTR.	80 JUL 19	
IDIECT				REPORT		
OUNTRY	Hungary					

INFORMATION REPORT REPORT INFORMATION

	gyanin Nasa Nasa Nasa	
SECRE	§	
		HUNGAULI.
		<u> </u>
		Red Ston Practor Factory
1.	Title and Gener	ral Data.
	Official name:	Vőrős Czillag Traktorgyar (Red Star Tractor Factory)
	Former Title:	
	Address:	3/15 Hofherr Albert-utca, Budapest XIX.
•	Abbreviated nar	ne: "VCST", colloquially known as: "Vöcsi"
		25X1
2.	Production.	
	(a) Rang	e of products:
	(i)	G35 tractor on iron wheels, powered by 25 h.p.
		glow-bulb Csepel engine.
	(ii)	Standard GS-35 tractor on iron or rubber tyred
		wheels, powered by 25 h.p. Csepel-Diesel engine
	(iii)	SL-50/55 tracked tractor (not continuously in
		production)
	(iv)	DT-413 tracked tractor, powered by 50 h.p. Csepel-
		Diesel engine.
	(v)	Potato-hoeing machine (self-propelled) 25X1
	(vi)	
	(vii)	Fl (and F3) coal cutter (production suspended in 1955)
	(viii)	25X1
	(ix)	Parts and components for tractors and agricultural
		machinery
	(x)	
		and larger sizes of links and pins for unknown types
	, .	of vehicles, possibly AFV
	(xi)	Nuts and bolts of many ranges
0	(xii)	057/4
SFCDET		of which are:-

SECRET CONTROL

- (a) Gears of 120 mm. diametre and over
- (b) Forging of shafts and other forging jobs requiring high degree of precision.
- (Xiii) Certain consumer goods, such as kitchen utensils and others. (These lines were undertakne with a view to utilising the material from rejects)

(b) Capacity and rate of production.

	Estimated capacity p. a.	Production 1955 (estimate)	Planned 1956 (estimate)	
Small tractors (G35, GS-35 & spare parts for same)	11,000	11,000	7,000 (a)	
SL-50/55 tractors	2,000	500(b)		
DT-4.13 tracked tractors of 50 h.p.	1,000	Production in prepara→ tion	Not known	25
S. C. The effects of the second all the distribution and a sound school second all the second al	and the second s	Residence of the Paris Control		
Coal cutters	500	Production was tinued in 1955	discon-	
Spares for coal cutters		small quanti→ ties were being pro→ duced		
Potato hoeing machines	2,000	A trial series was produced	?	
Wheels	50,000	72,000(a)	?	2
Gears for other concerns		240,000		

(a) The quantity of small tractors was to be reduced in order to provide more capacity for other products, particularly the DT-413 tracked tractor.

SECRET CUNTAUL

1. S. OFFICIALS ONLYpage 3....

5X1

25X1

- (b) These 500 tractors were the tail end of an order for China. It was questionable whether this type would be produced in the future, as further orders from China were uncertain.
- (c) This relatively large volume of production could only be got by working 10-hour shifts and by working on Sundays.

Destination of products. 3.

The	only large export commitment in 1955 was the	
delivery	of 500 SL-50/55 tractors for Ghina.	
All	other exports were small trial orders 25	5 X 1
	to many countries, among which were	5 X 1
China, Ch	ue U.S.S.R., Albania, Bulgaria	5 X 1
(b) <u>D</u> ome	estic destinations (civil).	
(i)	Tractors were supplies to agricultural tractor stations,	
	state farms and collective farms. 25X1	
(ii)	supplies to building concerns, mines	
	and others. 25X1	
(iii)	wheels were supplied to the Csepel Automobile Works.	
(iv)	Screws, bolts, nuts, washers, etc. were supplied to a	5 X 1
	number of larger concerns	
(v)	Gears, forgings, assemblies and components of machinery	
	requiring high precision characteristics were supplied to	

a large number of Hungarian engineering concerns, chiefly in cases where they had not themselves the types of machinetools for producing those parts,

(c) Clandestine destinations.

Officially this plant was not engaged on armaments orders, In practice, however, there was a large volume of contract work which could hardly have been anything but that. This was patent from the security measures by which the nature of these products and their

SEGRET CONTROL

destinations were concealed. Moreover many of the parts and assemblies were of types and sizes for which there was obviously no civil demand in Hungary.

The identities of most of the customers were not known to the workers in the shops. One of the few exceptions was that of the Mezogazdasagi Gepek Kutato Intezet (Research Institute for Agricultural Machines). This institute supplied drawings and specifications of components alledgedly needed for building prototypes of agricultural machines. They included all kinds of gears, gear and shaft assemblies, links and pins of heavy caterpillar tracks of elaborate design and many others. Very large sprocket wheels, with diametres of more than 700 mm. and weighing 35 Kg. each were machines and finished in large quantities. In general the series of individual parts were seldom less than 100 units. Sometimes the orders called for up to 500 units. Comments were heard from the engineering staff in which it was asserted that these orders could not be for prototypes of agricultural machines and that they could only apply to components of tanks, guns, self-propelled weapons and other armaments.

Inspite of security precautions the identities of some of the concerns with whom transactions were made became known. They included the DIMAVAG Engineering Works of Diosgyor, who were supplied with precision forgings, the Spare Parts Factory of Gyongyos, a secret factory at Eger and others. There were also continuous transactions with the Ozd Metallurgical Works,

4. POWER.

All power used was electrical, which was supplied from the city mains.

The factory also possessed a small generating plant of its own. It was operated only when the supply from the grid was insufficient. But its capacity was no more than perhaps 10% of the plant's requirements.

SECRET CONTROL -/Page 5.... 3. S. OFFICIALS ONLY

Labour,

(a) The total number of employees was about 4,900 of whom about 25% were women.

(b) The proportion of direct/productive personnel may be judged from the following approximate figures:-

	Direct productive	Indirect productive
Executive and other personnel with academic background		35
Staff with secondary school education		150
Foremen		100
Quality control inspectors		250
Office staff		300
Auxiliary personnel		170
Skilled manual labour	2,500	
Unskilled labour	1,000	
Casual labour and apprentices	400	The state of the s
Total:	3,900	1,005

- (c) The staff in the designing office consisted of about 30 employees.
- (d) The number of shifts and the total number of working hours depended largely on the period of the month:-

(i) From 1st to about 20th of the month

Work in the machining shops was generally in three 8-hour shifts on 6 days per week. The night shifts were with a strength reduced to about 60%. The efficiency was not more than about 30% of a day shift.

In the assembly shops work was in two 8-hour shifts and in the maintenance shops and certain servicing departments (welding, etc.) in one 8-hour shift per day, also on 6 days per week.

SECRET CONTRAL_{ge} 6....

(ii) Last 10 days of the month (Shock-working).

The number of shifts in most of the shops was increased and continued over Sunday. Moreover, the manpower strength of shifts was greatly increased, so much so that many workers did up to 48 hours work in overtime alone.

Plant and machinery.

6.

(a) The equipment and facilities available in 1955 are roughly listed and the serviceability of machine-tools evaluated in the following table:-

Item number on sketch	Plant and machinery	Serviceability (rating per cent)
<i>h</i> .	Two ponds from which water is drawn by Diesel-powered pumps for the boiler house	
7	Gas generator plant supplying own furnances as well as the nearby Lirinc Rolling Mill	
8	Iron Foundry:	en e
	2 cupola furnaces, large cap. 7 cupola furnaces, medium cap. ca 10 travelling cranes.	
9	Steel foundry:	and design of the state of the
	2 Electric furnaces of medium capacity 4 travelling cranes	
12	Tractor assembly (about 70 by 25m):	a fa allan distriction comment described and comment of the party legal, assessment great of the state of the comment of the c
	ca 10 sundry metal working machine 2 large capacity travelling cranes ca 10 smaller cranes	70% No conveyor belt system
13	Tractor section machining shop: (Concrete structure (ca 150 x 50m)	Newly comple- ted building.
	ca 20 Large boring machines of Hungarian & East German makes ca 10 Small drilling machines, capacity up to 5 mm. diametre ca 15 Milling machines (medium size) 6 Long planers, overall length about5-7 m., width of table 1.5 m. ca 10 Grinders (good condition) ca 20 Centre lathes ca 25 Turret lathes 2 Travelling cranes 6 Smaller cranes (There is no automation of any kind in this shop)	60% 90% 50% 90% (New machines) 90% about 60% about 60%

6. Plant and machinery continued

Item		
number on sketch	Plant and machinery	Serviceability
16	Bomb-proof shelter A large above-ground personnel concrete shelter, completed in May 1955. Contains no shops. Not in use.	25X1
17	Drying shop for tractors: Infra-red lamp tunnel for drying. Space for tuning and preparing tractors for tests. Several bays for welding	
18	Gear cutting shop: ca 15 Gear cutters for large sizes (out-dated types) ca 5 Gear cutters for large sizes (modern types) ca 20 Gear cutters for small and medium work, in fairly good condition ca 6 Shaping machines for gear cutting (old and outmoded)	7% 9% 6% 30%
20	Sundry workshops: This group of shops and other facilities contains a plate working shop, soldering shop, electrical fitting shop, general maintenance shop, carpenters and others, also the works canteen and offices. There are some 20-25 machine tools of all kinds	
21	So-called Nc.X Machining shop: (Large old hall used for production and other departments) 10 RF-2 Radial boring machines 5 RF-3 Large boring machines 8 Small drilling machines 2 Horizontal boring and milling machines for large jobs (new and up-to-date) 2 Vertical mills for large jobs 1 Planer 1 Planer 1 Planer 2 Millers for profile-cutting 6 Gear cutters of automatic machines, but old types	80% 80% 60% 90% 70% 90% 60% 40% 50%

25X1

25**X**1

25**X**1

SECRET CONTROL a. S. Officials only

-/Page 8....

6 ,	Plant	and	machinery	continued

number on sketch 21	Item	Plant and machinery	Serviceability	
contd. precision machines of Bast German make, producing high precision work 2 Gear polishing machines 1 Inside gear cutter 1 Inside gear cutter 2 Inside gear cutter 3 Soffinders 4 Medium milling machines 2 Medium shapers 5 Medium shapers 5 Medium copying 1 athes 2 "Wolman" precision lathes 3 "Bbringen" turret lathes 5 "Biringen" turret lathes 5 "Biringen" turret lathes 5 "Biringen" turret lathes 6 Ri-100 Lathe 2 Automatic copying lathes,	1			25X1
With the property of the control of	Ş .	precision machines 2 Gear polishing machines of East German make, producing high precision work 2 Gear polishing machines 1 Inside gear cutter 1 Inside gear cutter 2 Grinders 4 Medium milling machines 2 Medium shapers 4 Type EU Medium copying lathes 2 "Wolman" precision lathes 3 "Boringer" turret lathes 5 "Dimavag" centre lathes for large jobs 1 RH-100 Lathes 2 Automatic copying lathes, precision shafts, (These units were not allowed to operate continuously for longer than 8 hours) 4 "Magdeburg" turret lathes for large jobs (ortmoded) call Lathes for small work (old) 6 Automatic lathes with hydrau- lic chucks, made in Magdeburg, East Germany (of these machines the engineer in charge said: "These machines are not economical for civil production, only for armaments" (sic!) Three units were still in their packing cases. Three others were being used for training personnel to operate them) assembly hall: ? Travelling cranes (No automation of any kind) Painters' shop:	80% 60% 70% 50% 70% 50% 50% 50% 50% 30%	25X1
27 New shops under construction: This was nearing completion in 1955. Machinery was being fitted No information about the future	27	This was nearing completion in 1955. Machinery was being fitted		

SECRET TOWN AND Page 9....

Plant and machinery continued

6.

Item number on sketch	Plant and machinery	Serviceability	25X1
28	Old machining shop (&spares): ca 60 metal working machine-tools of all kinds, outmoded typres and in bad condition		
33	(So-called No. XII shop): (a) Bolts & nuts plant: ca 50 Small lathes of many types, mainly of Skoda make. A minor portion of the machine- tools were authomatic)	7%	
	(b) Small forge: l Cupola furnace (60 cu.m.) 2 Steam hammers (c) Stamping shop:	old	
	2 Cupola furnaces ca 9 Fresses (old) 2 Stamping machines (new) ca 50 Lathes, large and small, in poor condition, used for training apprentices	50% 70% 40%	
	(d) Metal cutting shop: ca 30 shears and saws, old and worn		
38	Steel cleaning shop: (new hall) ca 10 Sand blast apparatus ca 15 Sand blast guns (manual) ca 15 Large lathes (old) ca 10 Welding machines various grinders, etc.		·



25X1

(b) Vital tools lacking.

- (i) The number of grinding machines was insufficient. To offset this, work with grinders had extended to Sundays.
- (ii) The available domestic grinding wheels supplied by the GRANIT plant were unsatisfactory in quality and it was necessary to resort to the use of Swiss-made material. This, however, was always in short supply.
- (iii) In winter it was impossible to obtain the required temperature, at which the cutting machines produce the precise measurements.

 This caused an excessive reject rate.
- (dw) Among tools there was a lack of fine reamers, fine twist-drills, sorew taps and others.

(c) Instruments, gauges, etc.

- (1) Of the available manual measuring instruments an estimated 70% were lacking in precision.
- (ii) The quantity of such tools was quite insufficient.

 The greatest shortage was in micrometer screws and internal limit gauges. Shops were often held up for lack of measuring tools and it happened that a shop would be idle while waiting to get such instruments from one of the other shops. At times instruments had even to be borrowed from other concerns.
- (iii) There were three Laboratories for measuring quantity and quality and for checking the correctness of measuring tools. They were well equipped with up-to-date apparatus of all kinds.



- 11 -

(d) Mechanical handling equipment.

Apart from a limited number of cranes (listed in para, 6/a) and electric fork trucks, there is no mechanical handling equipment. The factory possesses no kind of transfer machinery or conveyor system. Work in the assembly halls proceeds in such manner that all the components are brought to the assembly bays by push part or electric fork truck.

7. Guality and quantity control.

(a) Quality control inspectors.

25X1

The works quality control has a strength of at least 250 inspectors. They carry out the following checks:

- The so-called "running inspector" controls
 the first specimen leaving a machine-tool and again
 other later specimens, say, every 50th out of
 200, if they are of small size, or every 4th
 or 5th, if the parts in question are of larger
 size.
- (11) The so-called "inter-operational inspection is made after completion of one operation and before the subsequent operation. The specimens found to be of reject quality are marked with red oil paint.
- (iii) After final completion of the product (tractor,


 larger assembly, etc.) it is inspected
 by the central section of the quality control

If accepted it is stamped with
the central inspector's number and marked with
the concern's trade mark. The trade marks are
either "VOST" framed with a stylized star if the

S. SFIGALS ON ...

25**X**1

25X1

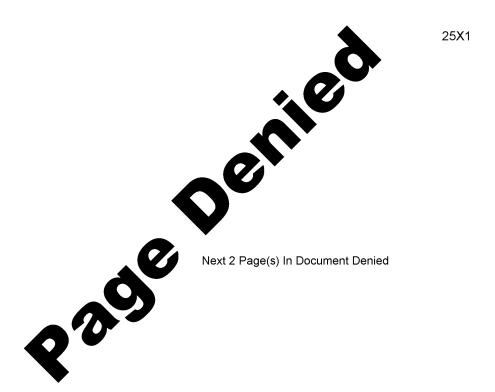

- (i) Lack of raw materials, coal or coke.
- (ii) Late arrival of semd-finished products from contracting concerns.
- (iii) Excessive reject rate in castings.
- (17) Power cuts.
- (v) Reject caused by faulty designing.
- (b) Serious bottlenecks could be artificially and deliberately caused by the following means:

25X1

- (ii) Damage to the designing office and the elimination of the design archives in building No. 32 (see sketch and para, 10) would severely hinder the operation of the plant).
- 10. Disposition of buildings and plants

Legend to attached sketch.

- 1. Fence consisting of paling about 2.7 m. high. At some point there are walls of buildings.
- 2. Railway spurs belonging to the plant.
- 3./a Main entrance for pedestrians and vehicles.
- 3./b Other gates (not always in use).
- 4. Two ponds (fitted with Diesel-powered pumps for supplying water to the boiler house).
- 5. Water tower.

⊷/Page 16....

SECRET CONTROL O. S. OFFICIALS ONLY

- 6. Dwelling houses. 7. Gas generator plant. 8. Iron foundry. 9, Steel foundry. 10. Dump for iron and steel, non-ferrous metals and coke. 11. Newly constructed store for spare parts, tyres, wires, etc. (Known as "general warehouse"). 12. Assembly hall for tractors (about 70 by 25 m.) 13. Tractor machining shop (new building, about 150 by 50 m). 25X1 14. Semi-finished components store. 15. Open parking space for completed tractors 16. New shelter for personnel, completed in May 1955. 17. Drying of tractors in infra-red tunnel and shop where new tractors are prepared and tuned before test running. This building also contains several welding shops. 18. Gear-cutting shop; measuring shop for quality control. 19a Transformers, switching station, boiler rooms and 25X1 2 smoke stacks. 20₀ Plate working shop, soldering shop, tinsmith shop: works canteen: electrical fitting shop; leatherworking shop; maintenance shop (for whole plant); carpenter's shop. No. 20 is not a single building, but a group of waildings each of which is close up to its neighbour). 25X1 2. Machine shop assembly hall; painting shop; quality control offices; electro-plating shop; quality control measuring, etc. 22. Dispatch of outgoing goods, loading of wagons, etc.
- 25. Apprentices school.

Garage and small fuel store.

26 Creche.

drums).

23.

24

SECRET CONTROL -/Page 17....

Works fire brigade and fuel dump (open air storage in

- 17 -

25X1

27. New workshops under construction and at a 70% stage of completion in 1955.

- 28. Old machining shop and spares store.
- 29. Offices (accounts dept., bookkeeping, finance dept., purchasing dept., stocks accounting, etc.)
- 30. Offices; maintenance shops; coal stores; on or near this building there is also a smoke stack.
- 31. Offices; Party office; trade union HQ; wages dept., labour matters; engagement of personnel; "discipline dept."; sports office, etc; smithles; annealing shops.
- 32. Main administration building; Director's office; Secretariat, Chief Engineer; cost accounting; designing offices, technical drawings, catalogues and archives; stencil duplicating and photo-copying dept.
- 33. Bolts and nuts production shop; forging and welding shops; hot-stamping shop; machine shops employing and training apprentices; metal saws shop; iron and steel deposit.
- 34. Surgery.
- 35. Offices used by tractor designing department.
- 36. Various warehouses; boilers.
- 37. Offices of power administration; clubs; library.
- 38. Shop for cleaning steel castings.

SECRET CONTROL V. S. OFFICIALS ONLY

